

# **Touch Pad Digital MultiMeter**

**USER MANUAL**

# Contents

<i><b>TITLE</b></i>	<i><b>PAGE</b></i>
<b>1. GENERAL INSTRUCTIONS</b>	1
1.1 Precaution safety measures	1
1.1.1 Preliminary	1
1.1.2 During use	3
1.2 Symbols	4
1.3 Instructions	4
<b>2. DESCRIPTION</b>	6
2.1 Instrument Familiarization	6
2.2 LCD Display	7
2.3 Touch pad	10
2.4 Back casing	13
<b>3. FUNCTION DESCRIPTION</b>	14
3.1 General Functions	14
3.1.1 DATA HOLD mode	14
3.1.2 Manual range and Autorange mode	14
3.1.3 Max/Min mode	14
3.1.4 Relative measurement mode	15
3.1.5 Memory mode	15
3.1.6 Review the data	15
3.1.7 Clear the data	16
3.1.8 RMS measurement	16
3.1.9 Automatic backlight	16
3.1.10 Automatic power off	16

3.1.11 Automatic Lock TouchPad	16
3.1.12 Test lead plug Indication	17
3.1.13 Red Backlight Alarm	17
3.1.14 Ambient temperature measurement	17
3.1.15 PT Temperature measurement	17
3.1.16 4-20 mA% Measurement	17
3.1.17 Sub-display frequency measurement	18
3.1.18 User settings	18
3.1.19 Function Table	20
3.2 Measurement Functions	21
3.2.1 AC and DC Voltage measurement	21
3.2.2 Resistance measurement	23
3.2.3 Capacitance measurement	24
3.2.4 Continuity Check	25
3.2.5 Diode Test	26
3.2.6 Frequency duty cycle measurement	27
3.2.7 Temperature measurement	28
3.2.8 Current measurement	29
3.3 Battery charge	30
<b>4. TECHNICAL SPECIFICATIONS</b>	<b>31</b>
4.1 General specifications	31
4.2 Measurement specifications	31
4.2.1 Voltage	32
4.2.2 Frequency	33
4.2.3 Resistance	33
4.2.4 Diode Test	34
4.2.5 Continuity Check	34

4.2.6 Capacitance	34
4.2.7 K-type Thermocouple Temperature	35
4.2.8 Current	35
<b>5. MAINTENANCE</b>	<b>36</b>
5.1 General maintenance	36
5.2 Fuse replacement	36
5.3 Battery replacement (Model A)	37
5.4 Battery Charge (Model B)	37
<b>6. ACCESSORIES</b>	<b>38</b>

## 1. GENERAL INSTRUCTIONS

This instrument complies with IEC 61010-1, CAT III 1000V and CAT IV 600V overvoltage standards. See Specifications.

- Touch pad operation.
- 6000 counts, dual value display.
- IP65 waterproof.
- CAT III 1000V / CAT IV 600V application.
- Auto backlight.
- Digital calibration.
- 2 color backlights for various operate status indication.
- Chargeable battery selection/ Micro USB charge

To get the best service from this instrument, please read carefully this user's manual and respect the detailed safety precautions.

International symbols used on the meter and in this manual are explained in chapter 1.2.

### 1.1 Precautions safety measures

#### 1.1.1 Preliminary

\* As the possibilities of high transient overvoltage occurred in today's power systems increase, more stringent safety standards are set for the electrical test equipment. Transients on electrical systems (power grid, feeder, or branch circuits) will trigger a series of incidents that may result in serious personal injury. To protect you against transients, safety must be built into the test equipment.

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

Overvoltage category	In brief	Examples
CAT I	Electronic	<ul style="list-style-type: none"><li>• Protected electronic equipment.</li><li>• Equipment connected to (source) circuits in which measures are taken to limit transient overvoltages to an appropriately low level.</li><li>• Any high-voltage, low-energy source derived from a highwinding resistance transformer, such as the high-voltage section of a copier.</li></ul>
CAT II	Single-phase receptacle connected loads	<ul style="list-style-type: none"><li>• Appliance, portable tools, and other household and similar loads.</li><li>• Outlet and long branch circuits.</li><li>• Outlets at more than 10 meters (30 feet) from CAT III source.</li><li>• Outlets at more than 20 meters (60 feet) from CAT IV source.</li></ul>
CAT III	Three-phase distribution, including single-phase commercial lighting	<ul style="list-style-type: none"><li>• Equipment in fixed installations, such as switchgear and polyphase motors.</li><li>• Bus and feeder in industrial plants.</li><li>• Feeders and short branch circuits, distribution panel devices.</li><li>• Lighting systems in larger buildings.</li><li>• Appliance outlets with short connections to service entrance.</li></ul>
CAT IV	Three-phase at utility connection, any outdoor conductors	<ul style="list-style-type: none"><li>• Refers to the “origin of installation”; i.e., where low-voltage connection is made to utility power.</li><li>• Electricity meters, primary overcurrent protection equipment.</li><li>• Outside and service entrance, service drop from pole to building, run between meter and panel.</li><li>• Overhead line to detached building, underground line to well pump.</li></ul>

\* When using this Multimeter, the user must observe all normal safety rules concerning:

- protection against the dangers of electric current.
- protection of the Multimeter against misuse.


\* For your own safety, only use the test probes supplied with the instrument. Before using, check that they are in good condition.

### **1.1.2 During using**

- \* If the meter is used near noise generating equipment, you should be aware that the display may become unstable or indicate large errors.
- \* Do not use the meter or test leads if they are damaged.
- \* Use the meter only as specified in this manual. otherwise, the protection provided by the meter may be impaired.
- \* Be careful when working around bare conductors or bus bars.
- \* Do not operate the meter around explosive gas, vapor, or dust.
- \* Verify a Meter's operation by measuring a known voltage. Do not use the Meter if it is abnormally. Protection may be impaired. When you are in doubt, there is after-sale service.
- \* Use the proper terminals, function, and range for your measurements.
- \* When the range of the value which to be measured is unknown, check that the range initially set on the multimeter is the highest, or you can choose the autoranging mode.
- \* To avoid damages to the instrument, do not exceed the maximum limits of the input values shown in the technical specification tables.
- \* When the multimeter is linked to measure circuits, do not touch the terminals which you do not use.
- \* Caution when working with voltages above 60Vdc or 30Vac rms. Such voltages pose a shock hazard.
- \* When using the probes, keep your fingers behind the finger guards.
- \* When making connections, please connect the common test lead before connecting the live test lead; when disconnecting, disconnect the live test lead before disconnecting the common test lead.
- \* Before changing functions, disconnect the test leads from the circuit under test.
- \* For all DC functions, including manual or auto-ranging, to avoid the risk of shock due to possible improper reading, verify the presence of any AC voltages by first using the AC function. Then select a DC voltage range equal to or greater than the AC range.
- \* Disconnect circuits power and discharge all high-voltage capacitors before testing resistance, continuity, diodes, or capacitance.
- \* Never perform resistance or continuity measurements on live circuits.
- \* Before measuring current, please check the meter's fuse and turn off power to the circuit before connecting the meter to the circuit.
- \* In TV repair work, or when carrying out measurements on power switching circuits, remember that high amplitude









## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

---

- voltage pulses at the test points can damage the multimeter. Use of a TV filter will attenuate any such pulses.
- \* Use just 3V battery, properly installed in the Meter's battery case, to power the Meter.
- \* Replace the battery as soon as the battery indicator (  ) appears. With a low battery, the Meter might produce false readings that can lead to electric shock and personal injury.
- \* Do not measure voltages above 1000V in Category III, or 600V in Category IV installations.
- \* When in REL mode, the "REL" symbol is displayed. Caution must be used because hazardous voltage may be present.
- \* Do not operate the Meter with the case (or part of the case) removed.

### 1.2 Symbols:

Symbols used in this manual and on the instrument:

-  **Caution:** refer to the instruction manual. Incorrect use may result in damage to the device or its components.
-  AC (Alternating Current)
-  DC (Direct Current)
-  AC or DC
-  Earth ground
-  Double insulated
-  Fuse
-  Conforms to European Union directives

### 1.3 Instructions


- \* Remove test leads from the Meter before opening the Meter case or battery cover.
- \* When servicing the Meter, use only specified replacement parts.
- \* Before opening up the instrument, always disconnect from all sources of electric current and make sure you are not charged with static electricity, which may destroy internal components.
- \* Any adjustment, maintenance or repair work carried out on the meter while it is live should be carried out only by

- appropriately qualified personnel, after having taken into account the instructions in this present manual.
- \* A "qualified person" is someone who is familiar with the installation, construction and operation of the equipment and the hazards involved. He is trained and authorized to energize and de-energize circuits and equipment in accordance with established practices.
  - \* When the instrument is opened up, remember that some internal capacitors can retain a dangerous potential even after the instrument is switched off.
  - \* If any faults or abnormalities are observed, take the instrument out of service and ensure that it cannot be used until it has been checked out.
  - \* If the meter is not going to be used for a long time, take out the battery and do not store the meter in high temperature or high humidity environment.

## 2. DESCRIPTION

### 2.1 Instrument Familiarization

Figure 2-1

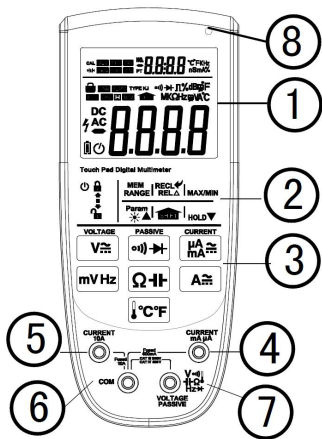

The front panel is shown as in Figure 2-1, explanation being as follows:

- 1 LCD display
- 2 Auxiliary function key pads
- 3 Measurement function key pads
- 4 mA / uA socket (uA, mA range red test lead input)
- 5 10A socket (A range red test lead input)
- 6 COM socket (black test lead input)
- 7 V Terminal (red test lead for voltage, resistance, capacitance, frequency, Temperature, diode and continuity measurements)
- 8 Light sensor (Use for auto backlight)








## 2.2 LCD Display







 

 
 

Figure 2-2

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

LCD screen is shown as in Figure 2-2, with its every symbol's meaning shown as in the Table 1:

No.	Symbol	Meaning
1		Indicates negative readings.
2	<b>AC</b>	Indicator for AC voltage or current.
3	<b>DC</b>	Indicator for DC voltage or current.
4		Indicator for AC voltage is greater than 30V or DC voltage is greater than 50V.
5		Low battery indication.
6		Power off indication.
7	<b>CAL</b>	Calibration mode indication.
8		Automatic shutdown time setting symbol.
9	<b>MEM</b>	Memory mode indication.
10	<b>RECL</b>	Review the data you saved.
11	<b>REL</b>	The meter is in Relative Measurement mode.
12	<b>MAX</b>	Display maximum data.
13	<b>MIN</b>	Display minimum data.
14	<b>NO.</b>	The number of the data you saved.
15	<b>PT</b>	Platinum thermal resistance.
16		Measurement units in the sub-display zone.
17		Indicates the meter is locked.

**TOUCH PAD DIGITAL MULTIMETER  
USER'S MANUAL**

18		The meter is in the Autorange mode in which the meter automatically selects the range with the best resolution.
19		The meter is in the manual range mode.
20		The meter is in Data Hold mode.
21		Shift key.
22		The meter is in Continuity Check mode.
23		The meter is in Diode Test mode.
24		Transmitter mA current test.
25		Measurement units.
26		This symbol means that the input is out of range.




Number	Explanation
①	<ol style="list-style-type: none"> <li>1.Slide this key to lock or unlock the digital multimeter.</li> <li>2.Slide down this key we can turn on the machine.</li> <li>3.Slide up this key twice quickly, we can turn off the meter.</li> </ol>
②	<p>When you measure the voltage, resistance or current.</p> <ol style="list-style-type: none"> <li>1.Touch <b>RANGE</b>② once to enter the manual ranging mode.</li> <li>2.Touch the key⑦, we can see the range of the measurement will be from large to small.</li> <li>3.Touch the key⑤, we can see the range of the measurement will be from small to large.</li> <li>4.Touch <b>RANGE</b>② again to exit auto ranging mode.</li> </ol>
③	<ol style="list-style-type: none"> <li>1.Touch the key③ to enter and exit the Relative measurement mode. (In addition to frequency and duty cycle)</li> </ol>
④	<ol style="list-style-type: none"> <li>1.Touch the key④ once, the LCD will display the maximum Value.</li> <li>2.Touch the key④ twice, the LCD will display the minimum Value.</li> <li>3.Touch this key again to exit.</li> </ol>
⑤	<ol style="list-style-type: none"> <li>1.Touch it to enter the Data Hold mode. And then touch it again to exit this function.</li> <li>2. At the memory mode, touch this key to page down.</li> </ol>
⑥	<ol style="list-style-type: none"> <li>1.Shift key.</li> <li>2.This key will be used to some key combination. It will be described in detail later.</li> </ol>
⑦	<ol style="list-style-type: none"> <li>1.In general, touch this key to turn on the backlight. Touch it again to turn off it.</li> <li>2.At the memory mode, touch this key to page up.</li> <li>3. Enter Clean memory mode, clean the memory save data. Refer 3.1.7</li> </ol>
⑧	<ol style="list-style-type: none"> <li>1.Touch this key to measure AC or DC voltage.</li> </ol>
⑨	<ol style="list-style-type: none"> <li>1.Touch this key to enter the continuity check mode.</li> <li>2.Touch this key again to enter the diode test mode.</li> </ol>

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

⑩	<ol style="list-style-type: none"><li>1.Touch this key to measure the DC current.</li><li>2.Touch this key twice to measure the AC current.</li><li>3.Touch this key three times to measure the duty cycle of waveform.</li></ol>
⑪	<ol style="list-style-type: none"><li>1.Touch this key to measure mV voltage.</li><li>2.Touch this key again to measure the frequency.</li></ol>
⑫	<ol style="list-style-type: none"><li>1.Touch this key to measure the resistance.</li><li>2.Touch this key again to measure the capacitance.</li></ol>
⑬	<ol style="list-style-type: none"><li>1.Touch this key to measure DC current.</li><li>2. Touch this key again to measure AC current.</li></ol>
⑭	<ol style="list-style-type: none"><li>1.Touch this key to measure the temperature.</li><li>2.Touch this key again to select the unit.</li></ol>

## 2.4 Back casing

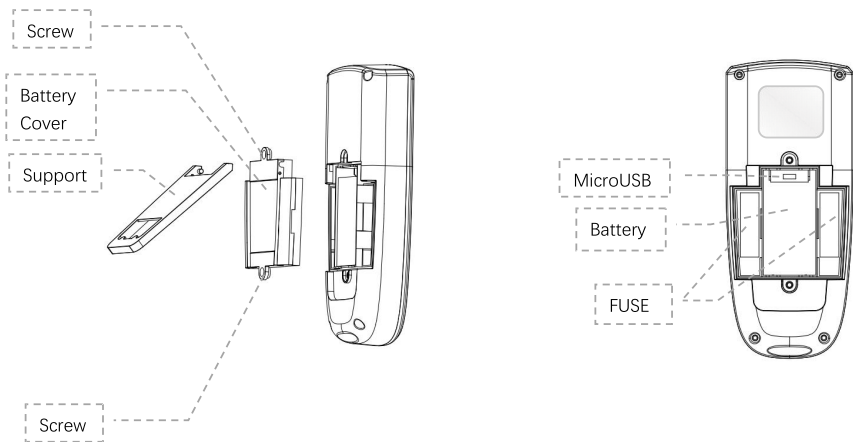

### 3. FUNCTION DESCRIPTION

#### 3.1 General Functions

##### 3.1.1 DATA HOLD mode

Data Hold mode makes the meter stop updating the displaying. If you want to exit this mode, you can change the measurement which you need.

1. Touch the key ⑤ once. Fixes the display on the current value, the symbol **H** is displayed on the screen.
2. A second touch to return the normal mode.

**NOTE:** If you manually change the measurement range after entering the Data Hold modes, the meter exits this mode.

##### 3.1.2 Manual range and Autorange mode

The meter has both manual range and autorange options.

\* In the autorange mode, the Meter selects the best range for the input detected. This allows you to switch test points without having to reset the range.

\* In the manual range mode, you can select the range. This allows you to override autorange and lock the meter in a specific range.

\* The meter defaults to the autorange mode in measurement functions that have more than one range. When the Meter is in the autorange mode, the symbol **AUTO** that is displayed on the screen.

##### To enter and exit the manual range mode:

1. Touch **RANGE** key ②. The meter enters the manual range mode. And then "**MANU**" will be displayed on the LCD.
2. Touch the key ⑤ or ⑦ to select range you need.
3. Touch **RANGE** key again to exit. The meter returns to the autorange mode and **AUTO** is displayed.

##### 3.1.3 Max/Min function

The Meter will display Maximum or Minimum reading at the sub-display area.  
Press **MAX/MIN** key ④, Maximum reading will display at the sub-display area.

Press again **MAX/MIN** key④, Minimum reading will display at the sub-display area.

Press again **MAX/MIN** key④, device will escape the MAX/MIN mode.

### 3.1.4 Relative measurement mode

The Meter will display relative measurement in all functions in addition to frequency.


To enter and exit the relative measurement mode:

1. With the Meter in the desired function, touch the test leads to the circuit on which you want future measurement to be based.
2. Touch **REL**△ key to store the measured value and activate the relative measurement mode. The difference between the reference value and subsequent reading is displayed.
3. Touch **REL**△ key again to return the Meter to normal operation.


### 3.1.5 Memory mode

For this function, the meter will save the data you need. we can save 10 data at most.

To enter and exit the memory mode:

- 1.Touch **SHIFT** key, the symbol  will be displayed on the screen.
- 2.Touch **RANGE** key to this mode.
- 3.Touch the key ⑤ to save the first data, touch it again to save the second data. A total of 10 data can be saved.
- 4.Touch the **RANGE** key to exit this function.



### 3.1.6 Review the data

- 1.Touch **SHIFT** key, the symbol  will be displayed on the screen.
- 2.Touch the key ③ to enter the mode.
- 3.Touch the key ⑤ or ⑦ to select the data you need.
- 4.Touch the **REL**△ key to exit this function.

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

---

### 3.1.7 Clear the data

- 1.Touch **SHIFT** key until the  symbol indicated.
- 2.Touch key , and then the “clr” symbol indicated.
- 3.Touch the **REL**△ key, the “yes” symbol will be displayed over 2 seconds. After the operation the data will be cleared.

### 3.1.8 RMS measurement






All the measurement values of the RMS meter on the AC voltage and AC current are true root-mean-square values. Frequency ranges from 10~400Hz.

### 3.1.9 Automatic backlight

When the light is weak, the machine will turn on the backlight automatically. You can press the key  to turn off the backlight. You can also enter the SET mode to set the threshold of automatic backlight.

### 3.1.10 Automatic Power off

When there is no any keys to be pressed, it reached the time you set. The buzzer will ring four times, and then the device will turn off.

- 1.Turn on the device. And then press the key  three times quickly.
- 2.Touch the key  or  to select the time you want to set. There are 0min (disable the automatic power off function), 10min, 30min, 60min, 90min, 120min.
- 3.Touch the key , and then touch the key  to save the setting.

### 3.1.11 Automatic Lock TouchPad

When the measured value is out of the 20% of the range, the touchpad will be locked. And the symbol “LOCK” will flash on the LCD. Until the user unlocks the device or the read value dropped to below 20%

### 3.1.12 Test lead plug Indication

When switching the measurement functions need to change the test lead terminal. The symbol "LEAD" will display on the LCD, and the red backlight indicate.

### 3.1.13 Red Backlight alarm

When the active measurement is out of range, the red backlight will turn on automatically. It means the measurement is over the range.

### 3.1.14 Ambient Temperature measurement

When the sub-display area has no function, the ambient temperature will be displayed in this area. For example, DC voltage, DC current, Diode, CONT, Resistor, Capacitor.

### 3.1.15 PT100 / PT1000 Temperature measurement

- 1.Touch the key **⑩** to the resistance measurement mode.
- 2.Touch the key **②**, then the symbol " $\Omega$ " will be displayed on the sub-display.
- 3.Touch the key **⑦** once to the PT1000.
- 4.Connect the PT100/PT1000 probe to the V terminal and the COM terminal. And the temperature will be displayed on the LCD. Types of support are PT100-385 or PT1000-3850, the range is -200 to 850° C.
5. Touch the key **⑦** again to return to the resistance measurement mode.

### 3.1.16 4-20mA%, 0-24mA%, 0-20mA% measurement

When you select the DC uA/mA, switch the ranges you can enter the 4-20mA% or 0-24mA% or 0-20mA%. The percentage of current. This function is always using in automatic control area. Such as transmitter, PLC etc. We need to connect the mA terminal and the COM terminal with the output of transmitter. Finally, we can read the value on the LCD.

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

---

1. Turn on the meter.
2. Touch the key ⑩ three times to enter this function. The symbol “ $\Pi\%$ ” will be shown on the screen.
3. Touch the key ②, the symbol “**MANU**” will be displayed on the LCD.
4. Touch the key ⑤ or ⑦ to select the range you need. There are three modes, including 0-20mA%, 0-24 mA%, 4-20 mA%.
- 5 Touch the key ⑩ again to exit.

### 3.1.17 Sub-display frequency measurement

When the device is under the AC voltage and AC current measurement function, the frequency will be displayed in the sub-display area.

### 3.1.18 User settings (SET mode)

Power up (load battery) the meter, and then press the key ④ “**MAX/MIN**” 2 times immediately.

Then we can enter the SET mode:

Set1: Automatic power off time setting.

LCD indicate “SET1” at sub-display.

You can select: OFF (disable this function), 10min, 30min, 60min, 90min, 120min.

Press key ⑤▼ or ⑦▲ to select the auto power off time.

Finish select, press REL key for save the setting.

Then press Range key to next setting, or power off device.

Set2: The threshold of automatic backlight setting.

LCD indicate “SET2” at sub-display, and “LIGH” at main-display.

You can place device at a dark environment (or cover the light sensor).

Finish select, press REL key for save the setting, LCD show on and backlight on.

Then press Range key to next setting, or power off device.

Set3: The temperature unit setting.

LCD indicate “SET3” at sub-display.

You can select: C (centigrade) or F (Fahrenheit).

Press key ⑤▼ or ⑦▲ to select the unit.

Finish select, press REL key for save the setting.

Then press Range key to next setting, or power off device.

Set4: The Ambient temperature calibration.

LCD indicate "SET4" at sub-display.

You can calibrate the ambient temperature and CJC temperature.

Press key ⑤▼ or ⑦▲ to increase or decrease the temperature. Set it same as the ambient temperature.








Short circuit the V-COM terminal.

Finish set, press REL key for save the setting. Wait 10second until LOCK flash again.

Then power off device.

**TOUCH PAD DIGITAL MULTIMETER**  
**USER'S MANUAL**

**3.1.19 Function table**

PAD	Default function	Alternate function	Range key selection	Range key reach function
	DC V		YES	N/A
		AC V + Hz	YES	N/A
	DC mV		YES	N/A
		AC mV + Hz	YES	N/A
		Frequency + Duty	N/A	N/A
	CONT		N/A	N/A
		DIODE	N/A	N/A
	Resistor		YES	PT100/PT1000
		Capacitor	N/A	N/A
	Temperature: thermocouple K-type		N/A	N/A
	DC uA/mA		YES	N/A
		AC uA/mA+ Hz	YES	N/A
		4~20mA%	0~24mA%/0~20mA%	
	DC A		YES	N/A
		AC A + Hz	YES	N/A

## 3.2 Measurement Functions

### 3.2.1 AC and DC Voltage measurement

⚠ *To avoid electrical shock and/or damage to the instrument, do not attempt to take any voltage measurement that might exceeds 1000Vdc or 1000Vac rms.*

*To avoid electrical shock and/or damage to the instrument, do not apply more than 1000Vdc or 1000Vac rms between the common terminal and the earth ground.*


The Meter's voltage ranges are 600.0mV, 6.000V, 60.00V, 600.0V and 1000V.

To measure ac or dc voltage (set up and connect the Meter as shown in Figure 3-1):

#### AC VOLTAGE

1. Turn on the device.
2. Touch the key  $\text{Ⓢ}$ , the meter will enter the ACV range.
3. Connect the black and red test leads to the COM and V terminals respectively.
4. Connect the test leads to the circuit being measured.
5. Read the displayed value.

AC Voltage

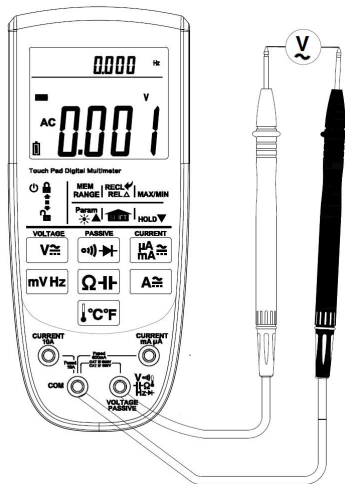

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

### DC VOLTAGE

1. Turn on the device.
2. The meter will enter the DCV range.
3. Connect the black and red test leads to the COM and V terminals respectively.
4. Connect the test leads to the circuit being measured
5. Read the displayed value. The polarity of red test lead connection will be indicated when making a DCV measurement.

### mv VOLTAGE

1. Turn on the device.
2. Touch the key (F1) once to enter the DCmV range. Touch the key twice to enter the ACmV range. Touch it three times, it will enter the frequency measurement mode.
3. Connect the black and red test leads to the COM and V terminals respectively.
4. Connect the test leads to the circuit being measured

### NOTE:

- Unstable display may occur especially at 600mV range, even though you do not put test leads into input terminals  
For better accuracy when measuring the DC offset of an AC voltage, measure the AC voltage first. Note the AC voltage range, then manually select a DC voltage range

### DC Voltage



Figure3-1 Measuring AC and DC Voltage

### 3.2.2 Resistance measurement

**⚠ To avoid electrical shock and/or damage to the instrument, disconnect circuit power and discharge all high-voltage capacitors before measuring resistance.**

The Meter's resistance ranges are 600.0 $\Omega$ , 6.000k $\Omega$ , 60.00k $\Omega$ , 600.0k $\Omega$ , 6.000M $\Omega$  and 55.00M $\Omega$ .

To measure resistance (set up the Meter as shown in figure 3-2):

1. Touch  $\Omega$ -H key  $\text{Ⓜ}$  once to enter the resistance measurement mode. Touch it twice to measure capacitance.
2. Connect the black and red test leads to the COM and V $\Omega$  terminals respectively.
3. Connect the test leads to the circuit being measured and read the displayed value.

#### Some tips for measuring resistance:

- The measured value of a resistor in a circuit is often different from the resistor's rated value. This is because the Meter's test current flows through all possible paths between the probe tips.
- In order to ensure the best accuracy in measurement of low resistance, short the test leads before measurement and memory the test probe resistance in mind. This necessary to subtract for the resistance of the test leads.
- The resistance function can produce enough voltage to forward-bias silicon diode or transistor junctions, causing them to conduct. To avoid this, do not use the 55M $\Omega$  range for in-circuit resistance measurements.
- On 55M $\Omega$  range, the meter may take a few seconds to stabilize reading. This is normal for high resistance measuring.
- When the input is not connected, i.e., at open circuit, the figure "OL" will be displayed for the overrange condition.

Resistance

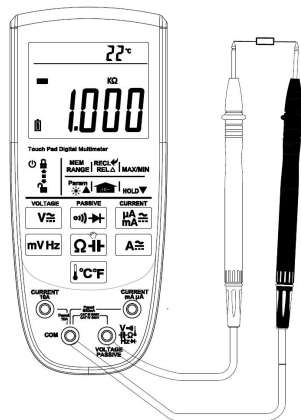


Figure 3-2 Measuring Resistance

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

### 3.2.3 Capacitance measurement

**⚠** To avoid electrical shock and/or damage to the instrument, disconnect circuit power and discharge all high-voltage capacitors before measuring capacitance. Use the dc voltage function to confirm that the capacitor is discharged.

The Meter's capacitance ranges are 1.000nF, 10.00nF, 100.0nF, 1.000 $\mu$ F, 10.00 $\mu$ F, 100.0 $\mu$ F, 1.000mF and 10.00mF. To measure capacitance (set up the Meter as shown in Figure 3-3):

1. Touch  $\Omega$   $\rightarrow$  key  $\text{Ⓜ}$  twice to enter the capacitance measurement mode.
2. Connect the black and red test leads to the COM and  $\rightarrow$  terminals respectively (or you can use capacitor test lead).
3. Connect the test leads to the capacitor being measured and read the displayed value.

#### Some tips for measuring capacitance:

- The meter may take a few seconds (>30 seconds > 60.0 $\mu$ F range) to stabilize the reading. This is normal for high capacitance measuring.
- To improve the accuracy of measurements less than 10nF, subtract the residual capacitance of the Meter and leads.
- Below 600pF, the accuracy of measurements is unspecified.

Capacitance



Figure 3-3 Measuring Capacitance

### 3.2.4 Continuity Check

**⚠** To avoid electrical shock and/or damage to the instrument, disconnect circuit power and discharge all high-voltage capacitors before testing for Continuity.

To test for continuity (set up the Meter as shown in Figure 3-4):

1. Touch the key **🔊** once to enter the continuity check mode.
2. Connect the black and red test leads to the COM and  $\Omega$  terminals respectively.
3. Connect the test leads to the resistance in the circuit being measured.
4. When the test lead to the circuit is below  $50\Omega$ , the buzzer will sound. And the Red backlight will indication.

#### NOTE:

- Continuity test is available to check open/short of the circuit.

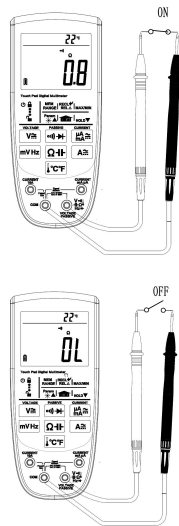


Figure 3-4 Checking the Continuity

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

### 3.2.5 Diode Test

**⚠ To avoid electrical shock and/or damage to the instrument, disconnect circuit power and discharge all high-voltage capacitors before testing diodes.**

To test a diode out of a circuit (set up the Meter as shown in Figure 3-5):

1. Touch the key **Ⓢ** twice to enter the Diode Test mode.
2. Connect the black and red test leads to the COM and  $V\Omega$  terminals respectively.
3. For forward-bias readings on any semiconductor component, place the red test lead on the component's anode and place the black test lead on the component's cathode.
4. The meter will show the approximate forward voltage of the diode.

In a circuit, a good diode (the material of Si) should still produce a forward bias reading of 0.5V to 0.8V. However, the reverse-bias reading can vary depending on the resistance of other pathways between the probe tips.

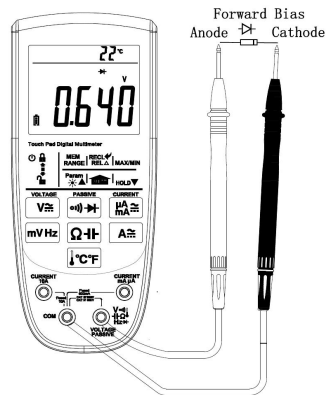


Figure 3-5 Diode Test

### 3.2.6 Frequency and Duty Cycle measurement


**⚠ Do not measure Frequency on high voltage (>1000V) to avoid electrical shock hazard and/or damage to the instrument.**

The Meter can measure frequency or duty cycle while measuring Hz. To measure frequency or Duty Cycle:

1. Touch the **mvHz** key **①** three times to enter frequency and duty cycle measurement as it is shown in the picture.
2. Insert the black and red test leads into the COM and Hz input terminals.
3. Read the percent of duty cycle on the subdisplay.
4. Connect the test leads tip in parallel with the circuit to be measured. And don't touch any electrical conductors.
5. Touch **mvHz** key **①** again to exit.

**NOTE:**

In noisy environment, it is preferable to use shield cable for measuring small signal

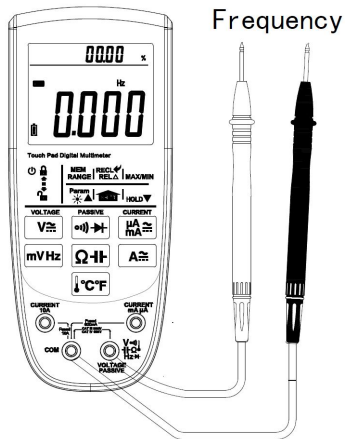


## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

### 3.2.7 Temperature measurement

- ⚠** To avoid electrical shock and/or damage to the instrument, do not apply more than 250Vdc or 220Vac rms between the °C terminal and the COM terminal.  
To avoid electrical shock, do not use this instrument when voltages at the measurement surface exceed 60v dc or 24v rms. Ac.  
To avoid damage or burns. Do not make temperature measurement in microwave ovens.

To measure temperature:

1. Touch the key **14**, the temperature will be shown in the subdisplay zone. Sub-display shows another unit.
2. Insert the 'K' type thermocouples into the COM terminal and °C terminal. Please make sure the polarity is correct.
3. Touch the object with the thermocouple probe for measurement.
4. Read the stable value from LCD.

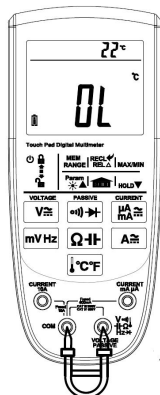

Thermocouple

### 3.2.8 Current measurement



**⚠ To avoid damage to the Meter or injury if the fuse blows, never attempt an in-circuit current measurement where the open-circuit potential to earth is greater than 1000V.**

**To avoid damage to the meter, check the meter's fuse before proceeding. Use the proper terminals, function, and range for your measurement. Never place the probes in parallel with a circuit or component when the leads are plugged into the current terminals.**

The Meter's current ranges are 600.0  $\mu$ A, 6000  $\mu$ A, 60.00mA, 600.0mA, 6.000A and 10.00A.

To measure current (set up the Meter as shown in the picture):

1. Turn off power to the circuit.
2. Touch the key **Ⓜ** to select the DC current or AC current.
3. Connect the black test lead to the COM terminal the red test leads to the 10A terminal or mA $\mu$ A terminal. (>600mA please use 10A range/terminal)
4. Break the circuit path, and in series the test lead.
5. Turn on the power of the circuit, read the LCD.

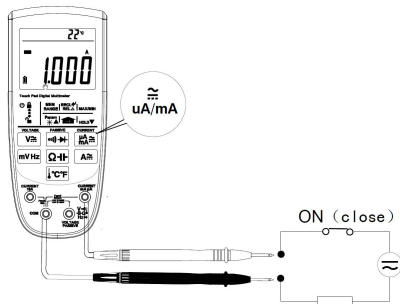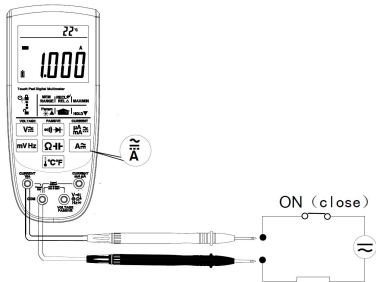

\* mA% range include: 4~20mA%/0~24mA%/0~20mA%

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

---

### To measure the $\mu\text{A}$ and $\text{mA}$

1. Turn off the power of the circuit. Discharge all high voltage capacitors.
2. Touch the key **⑩** once to select the DC  $\mu\text{A}$  and DC  $\text{mA}$  range. Touch it twice to the AC  $\mu\text{A}$  and AC  $\text{mA}$  range. The meter is in autorange mode, it can according to the current value which is measured to select the range automatically.
3. Connect the black test lead to the COM terminal and the red test leads to the  $\text{mA}$   $\mu\text{A}$  terminal
4. Break the circuit path to be tested.  
Touch the black probe to the more negative side of the break; touch the red probe to the more positive side of the break. (Reversing the leads will give a negative reading, but will not damage the Meter.)
5. Turn on power to the circuit; then read the display. Be sure to note the measurement units at the right side of the display ( $\mu\text{A}$ ,  $\text{mA}$ ). When only the figure "OL" displayed, it indicates overrange situation and the higher range have been selected.
6. Turn off power to the circuit and discharge all high voltage capacitors. Remove the Meter and restore the circuit to normal operation.

### 3.3 Battery charge

When device support chargeable function, it can use USB cable for charge battery.

USB charge: Disconnect any input terminal, remove the battery cover, plug-in Micro-USB cable with charge adaptor.

Charge adaptor supply 5V-DC@500mA.

Device LCD will show "CHrG" symbol, and battery level will increase.

Do not USE device while charge.

After charge finish, remove USB cable and assemble battery cover again.

Wireless charge: Disconnect any input terminal, put the device above the wireless charge adaptor (QI).

If the adaptor indicates blue and device LCD show "CHrG" symbol. Then it is on charge process.

Else adjust the position of device, make the charge area match both.

Charge battery type is Lithium chargeable battery (103450, size 10\*34\*50mm, 2000mAh, 3.7V).

**\* USB charge exist at Model B.**

## 4. TECHNICAL SPECIFICATIONS

### 4.1 General specifications

Environment conditions:

1000V CAT III and 600V CAT IV

Pollution degree: 2

Altitude < 2000m

Operating temperature: 0~40°C, 32°F~104°F (<80% RH, <10°C non-condensing)

Storage temperature: -10~60 °C, 14°F~140°F (<80% RH, battery removed)

Temperature Coefficient: 0.1×(specified accuracy) / °C (<18°C or >28°C)

MAX. Voltage between terminals and earth ground: 1000V AC rms or 1000V DC.

Fuse Protection: μA and mA: F 0.63A/1000V Ø10.3×38; A: F 10A/1000V Ø10.3×38.

Sample Rate: 3 times/sec for digital data.

Display: 3 5/6 digits LCD display. Automatic indication of functions and symbols.

Range selection: automatic and manual.

Over Range indication: LCD will display "OL".

Low battery indication: The "⏏" is displayed when the battery is under the proper operation range.

Polarity indication: "-" displayed automatically.

Power source: 3V =

Battery type: AA\*2, or chargeable Lithium battery 3.7V.

Dimensions: 190(L)×90(W)×40(H) mm.

Weight: 500g. Approx. (battery included).

### 4.2 Measurement specifications

Accuracy is specified for one year after calibration, at operating temperatures of 18°C to 28°C, with relative humidity at less than 80%.

Accuracy specifications take the form of: ± (% of Reading + Number of Least Significant Digits)

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

---

### 4.2.1 Voltage

DCV:

Range	Resolution	Accuracy
60mV	0.01mV	$\pm(0.1\%$ of rdg +5 digits)
600mV	0.1mV	$\pm(0.1\%$ of rdg +2 digits)
6V	1mV	$\pm(0.15\%$ of rdg +2 digits)
60V	10mV	
600V	100mV	
1000V	1V	$\pm(0.15\%$ of rdg +2 digits)

ACV:

Range	Resolution	Accuracy
60mV	0.01mV	$\pm(0.8\%$ of rdg +10 digits)
600mV	0.1mV	$\pm(0.8\%$ of rdg + 3 digits)
6V	1mV	
60V	10mV	
600V	100mV	$\pm(0.8\%$ of rdg + 5 digits)
1000V	1V	

Above accuracies can be guaranteed within 5%~100% of the full range.

The true RMS meter has residual value within 10 counts when the test leads are shorten, but that will not affect the accuracy of measurement.

1. Frequency Range for ACV: 40Hz~400Hz.
2. Response for ACV: RMS, calibrated in rms of sine wave.
3. Overload Protection: 1000V dc or 1000V ac rms.
4. Input Impedance (Nominal): DC voltage:  $>9M\Omega$ ; AC voltage:  $>9M\Omega$
5.  $<100$ counts Frequency will not display. (@60mV range  $<30.00$ mV)

#### 4.2.2 Frequency

##### Logic frequency (1Hz-1MHz)

Range	Resolution	Accuracy
9.999Hz	0.001Hz	$\pm(0.1\% \text{ of rdg}+3\text{digits})$
99.99Hz	0.01 Hz	
999.9Hz	0.1 Hz	
9.999kHz	0.001kHz	
199.99kHz	0.01kHz	

##### Linear frequency (6Hz~10KHz)

Range	Resolution	Accuracy
99.99Hz	0.01 Hz	$\pm(0.5\% \text{ of rdg}+5\text{digits})$
999.9Hz	0.1 Hz	
9.999kHz	0.001kHz	

Above accuracies can be guaranteed within 10%~100% of the full range in voltage measurement and within 20%~100% of the full range in current measurement.

#### 4.2.3 Resistance

Range	Resolution	Accuracy
600.0 $\Omega$	0.1 $\Omega$	$\pm(0.5\% \text{ of rdg}+3 \text{ digits})$
6.000k $\Omega$	1 $\Omega$	$\pm(0.5\% \text{ of rdg}+3 \text{ digits})$
60.00k $\Omega$	10 $\Omega$	
600.0k $\Omega$	100 $\Omega$	
6.000M $\Omega$	1k $\Omega$	$\pm(1.5\% \text{ of rdg}+5 \text{ digits})$
55.00M $\Omega$	10k $\Omega$	
PT100	0.4 $^{\circ}\text{C}$	-200~850 $^{\circ}\text{C}$ $\pm(1.0\% \text{ of rdg}+ 1^{\circ}\text{C})$
PT1000	0.4 $^{\circ}\text{C}$	-200~850 $^{\circ}\text{C}$ $\pm(1.0\% \text{ of rdg}+ 1^{\circ}\text{C})$

## TOUCH PAD DIGITAL MULTIMETER USER'S MANUAL

### 4.2.4 Diode Test

Range	Resolution	Test Condition
3 V	0.001V	Forward DC current approximately 1mA. Reversed DC voltage approximately 3V.

### 4.2.5 Continuity Check

Range	Resolution	Test Condition
600 $\Omega$	0.1 $\Omega$	Open circuit voltage: approx. 0.5V

Description: Continuity beeper $\leq$ 50 $\Omega$

### 4.2.6 Capacitance

Range	Resolution	Accuracy
1.000nF	1pF	$\pm(3.0\%$ of rdg +10 digits)
10.00nF	10pF	$\pm(3.0\%$ of rdg +10 digits)
100.0nF	100pF	$\pm (5.0\%$ of rdg+10 digits)
1.000 $\mu$ F	1nF	
10.00 $\mu$ F	10nF	
100.0 $\mu$ F	100nF	
1.000mF	1 $\mu$ F	$\pm (8.0\%$ of rdg+20 digits)
10.00mF	10 $\mu$ F	$\pm (10\%$ of rdg+30 digits) typical

### 4.2.7 K-type Thermocouple Temperature

Range	Resolution	Accuracy
-200 $^{\circ}$ C~0 $^{\circ}$ C	0.1 $^{\circ}$ C	$\pm(3.0\%$ of rdg + 3 $^{\circ}$ C)
1 $^{\circ}$ C~400 $^{\circ}$ C		$\pm(2.0\%$ of rdg+ 3 $^{\circ}$ C)
401 $^{\circ}$ C~1000 $^{\circ}$ C	1 $^{\circ}$ C	$\pm 2.0\%$ of rdg

Note: The specifications of temperature don't include thermocouple errors.

#### 4.2.8 Current

DCA:

Range	Resolution	Accuracy
600 $\mu$ A	0.1 $\mu$ A	$\pm(1.0\%$ of rdg+3 digits)
6000 $\mu$ A	1 $\mu$ A	
60mA	0.01mA	$\pm(1.0\%$ of rdg+3 digits)
600mA	0.1mA	
6A	1mA	$\pm(1.5\%$ of rdg+5 digits)
10A	10mA	

ACA:

Range	Resolution	Accuracy
600 $\mu$ A	0.1 $\mu$ A	$\pm(1.8\%$ of rdg+5 digits)
6000 $\mu$ A	1 $\mu$ A	
60mA	0.01mA	$\pm(1.8\%$ of rdg+5 digits)
600mA	0.1mA	
6A	1mA	$\pm(2.0\%$ of rdg+8 digits)
10A	10mA	

Above accuracies can be guaranteed within 5%~100% of the full range.

The true RMS meter has residual value within 10 counts when the test leads are shorten, but that will not affect the accuracy of measurement.

1. Frequency Range for ACA: 40Hz-400Hz
2. Overload protection: F 10A/1000V fuse for 10A  
Overload protection: F 0.63A/1000V fuse for  $\mu$ A and mA ranges.
3. Maximum input current: 600mA dc or 600mA ac rms for  $\mu$ A and mA ranges, 10A dc or 10A ac rms for 10A ranges.
4. For measurements>6A, 4 minutes maximum ON to measure 10 minutes OFF; Above 10A unspecified.

## **5. MAINTENANCE**

This section provides basic maintenance information, including fuse and battery replacement instructions. Do not attempt to repair or service your Meter unless you are qualified to do so and have the relevant calibration, performance test, and service information.

### **5.1 General Maintenance**

**⚠ *To avoid electrical shock or damage to the meter, do not get water inside the case. Remove the test leads and any input signals before opening the case***

Periodically wipe the case with a damp cloth and mild detergent. Do not use abrasives or solvents. Dirt or moisture in the terminals can affect readings.

To clean the terminals:

Turn the meter off and remove all test leads.

Shake out any dirt that may be in the terminals.

Soak a new swab with a cleaning and oiling agent (such as WD-40).


Work the swab around in each terminal. The oiling agent insulates the terminals from moisture-related contamination.

### **5.2 Fuse replacement**

**⚠ *Before replacing the fuse, disconnect test leads and/or any connectors from any circuit under test. To prevent damage or injury replace the fuse only with specified ratings.***


1. Power off device.
2. Disconnect test leads and/or any connectors from the terminals.
3. Use a screwdriver to unlock the 2 screws on the battery cover.
4. Take out the battery cover from the meter.
5. Remove the fuse by gently prying one end loose, then sliding the fuse out of its bracket.
6. Install the replacement fuses only with specified ratings: F 0.63A/1000V  $\varnothing$ 10.3×38 and F 10A/1000V  $\varnothing$ 10.3×38
7. Rejoin the battery cover and tighten the screws.

### 5.3 Battery replacement (Model A)

**⚠ To avoid false readings, which could lead to possible electric shock or personal injury, replace the battery as soon as the battery indicator (  ) appears. Before replacing the battery, disconnect test leads and/or any connectors from any circuit under test, turn the meter off and remove test leads from the input terminals.**

1. Disconnect test leads and/or any connectors from the terminals.
2. Use a screwdriver to unlock the screws on the battery cover.
3. Take out the battery cover from the meter.
4. Remove the used battery.
5. Replace with 2pcs new AA battery.
6. Rejoin the battery cover and tighten the screws.
  - \* When Low battery, sub-display will show "BATT"

### 5.4 Battery Charge (Model B)

**⚠ To avoid false readings, which could lead to possible electric shock or personal injury, charge the battery as soon as the battery indicator (  ) appears. Before charging the battery, disconnect test leads and/or any connectors from any circuit under test, turn the meter off and remove test leads from the input terminals.**

When the battery voltage is low, you can charge for the battery.

1. Remove any test lead.
2. Remove the screw on the battery cover
3. Plug in the Micro-USB power adaptor to the socket inside the battery room.
4. LCD will show the battery bar increase.
  - \* When the device supports wireless charging, do not open battery cover and put device on the wireless charge adaptor.
  - \* When Low battery, sub-display will show "BATT".

## **6. ACCESSORIES**

- |                         |                              |
|-------------------------|------------------------------|
| • User's manual         | One piece                    |
| • Test leads            | One pair                     |
| • "K" type Thermocouple | One piece                    |
| • Micro-USB cable       | One piece *only for Model B  |
| • 1.5V AA battery       | Two pieces *only for Model A |



