


TENMARS



DIGITAL INSULATION TESTER YF-509

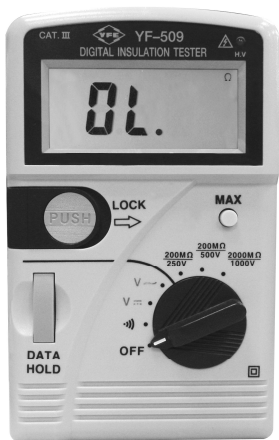

OPERATING
MANUAL

HB2YF5090000

TENMARS ELECTRONICS CO., LTD

CONTENTS

1. FEATURES.....	3
2. SPECIFICATIONS	4
2-1 General Specifications	4
2.2 Electrical Specifications:.....	6
3. EXTERIOR FEATURES	8
4. MEASUREMENT	9
5. BATTERY REPLACEMENT.....	12
6. SYMBOL/ABBREVIATION EXPLANATION.....	13
7. PRECAUTIONS.....	13
8. IMPORTANT RECOMMENDATIONS	15


Thank you for your patronage. Before using this insulation meter, please carefully read the instructions below to allow proper operation, minimize damage and getting the best performance from this instrument.

1. FEATURES

- Measures high insulation resistance ($0.1\text{M}\Omega \sim 2000\text{M}\Omega$), manual range , of $200\text{M}\Omega / 250\text{V}$, $200\text{M}\Omega / 500\text{V}$ and $2000\text{M}\Omega / 1000\text{V}$.
- Measures DC voltage ($0\text{ V} \sim 1000\text{V}$), AC Voltage ($0\text{V} \sim 750\text{V}$).
- The unit has select able long duration and momentary operation switches for high resistance measurements.
- Has a DATA HOLD switch to hold LCD readings.
- Has a Maximum Reading Hold function.


2. SPECIFICATIONS

2-1 General Specifications

- Display :
3 1/2 digit LCD that indicates values up to 1999, units, decimal point and symbols.
- Polarity indication : Automatically displays “ - “ symbol during negative input.
- Zero adjustment : Automatic zeroing.
- Overload indication :
Display the highest “OL” at left side.
- Low battery indication :
Replace battery as LCD displays “”.
- Sampling rate : 2.5 times/second.
- Power supply : 1.5V x 8 NEDA 15F IEC R6 JIS UM-3
- Battery life : 100 hours

Note:

Power consumption is greatest when operating in the 250V, 500V and 1,000V ranges or when measuring high insulation resistance. Battery life will be reduced if operation is frequently in these ranges.

- Operation height : 2000M under the elevation above sea level.
- Installation categories III. Double and Reinforce Insulation .
- Operation environment : for indoor use , pollution degree 2.
- Operating temperature and humidity : 0°C~40°C at less than 80% RHD.
- Storage temperature and humidity : -10°C~60°C below 70% RH.
- Dimensions and weight : 160 x 100 x 52mm, about 480g (incl. Battery).
- Accessories : Ohm probe -1 set, case -1 pcs), batteries- 8 PCs and operation manual.

2.2 Electrical Specifications:

(23°C±5°C, below 80%RH).

Accuracy : ±(. . . % reading + . . . digits)

DC Voltage

Range	Resolution	Accuracy	Input Impedance	Overload Protection
DCV	1V	±(0.5% +1)	10MΩ	DC 1000V AC 750V rms

AC Voltage

Range	Resolution	Accuracy	Input Impedance	Overload Protection
DCV	1V	±(0.8% +4)	10MΩ	DC 1000V AC 750V rms


Insulation High-resistance

Range	Resolution	Accuracy	Tolerance
200M/250V	0.1MΩ	±(3%+3)	0.4mA max
200M/500V	0.1MΩ		0.9mA max
2000M/1000	1 MΩ	±(3%+5)	1.7mA max

Measurement Voltage

Range	Terminal Measurement open Voltage	Supported Range Terminal Voltages
250V/ 50M Ω	Rated voltage $\pm 10\%$	When the resistance is in the 1M Ω range, the rated voltage should reach up to 90%.
500V/ 1000M Ω	Rated voltage $\pm 10\%$	When the resistance is in the 20M Ω range, the rated voltage
1000V/ 2000M Ω	Rated voltage $\pm 10\%$	When the resistance is in the 50M Ω range, the rated voltage should reach up to 90%.

3. EXTERIOR FEATURES

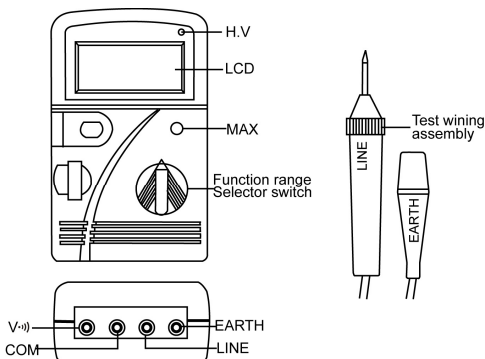

- (1). Liquid crystal display (LCD) : Displays measurement readings, all numerical units, symbols and range indications.
- (2). H.V : High voltage output indication.
- (3). LOCK switch : Used for extended duration MΩ measurements.
- (4). PUSH switch : Used for momentary duration MΩ measurements.
- (5). D-HOLD : Holds displayed readings.
- (6). Function range selector switch : Meter function range selection

indication.

- (7). V / \cdot) test socket : Positive input terminal for AC/DC voltages and continuity testing.
- (8). EARTH test socket: Positive input terminal for high voltage output M Ω resistance measurements.
- (9). Test wiring assembly.
- (10). MAX : Lock up max. Value of LCD.
- (11). LINE test socket : Negative input terminal for m Ω resistance measurements.
- (12). COM test socket : For connection of negative input terminal. AC/DC Voltages and continuity tests.

4. MEASUREMENT

Direct Current Voltage (DCV) and Alternating Current Voltage (ACV) measurement.

- (1). Select the V \equiv or V \sim
- (2). Insert the red test probe into the " V / \cdot) " socket and the black test probe into the "COM" socket.

- (3). Measure voltage with the two tips of the test probes (by contacting a test circuit).
- (4). The value of the voltage\read will be displayed on the LCD screen.

Continuity Test

- (1). Insert the red test probe into the " V/ ·))) " socket and the black test probe into the "COM" socket.
- (2). Move the function switch to the " ·))) " range.
- (3). Place the probes in series with the circuit (a pure resistance circuit) to be tested.
- (4). A continuous beeps will sound when the resistance is less than 80Ω and the resistance value displayed on the LCD screen.

Note :

Continuity tests should only be conducted on a purely resistive circuit having no voltage or current present.

High Resistance Insulation Test






- (1). Insert the red test probe into the "LINE" socket and the black test probe into the "EARTH" socket.
- (2). Turn the function switch to the 200M Ω /250V, 200M Ω /500V or 2000M Ω /1000V position (according to the voltage level).
- (3). Connect the red test probe (LINE) to center conductor of the line to be tested and connect the black test probe (EARTH) to the insulator surface.
- (4). Press the "PUSH" switch to allow measurement of the high voltage output. If measurement is to be conducted for an extended duration, move the "LOCK" switch from left to right to enter this testing mode.
- (5). The resistance reading will be displayed on the LCD screen.

5. BATTERY REPLACEMENT

The meter is powered by 1.5V battery x8pcs (NEDA 15F IEC R6 JIS UM-3). use the following procedure to replace the battery:

- (1). Move the function switch to the "OFF" position.
- (2). Use a screw driver to unfasten the screws on the battery cover and remove the cover.
- (3). Take out the old batteries and replace with new batteries, taking care to note the correct polarity.
- (4). Re-install the battery cover and tighten the holding screws.

6. SYMBOL/ABBREVIATION EXPLANATION

- 1)  : indicates direct current.
- 2)  : indicates alternating current.
- 3)  : indicates ground.
- 4)  : indicates double insulation.
- 5)  : indicates high voltage hazard.

7. PRECAUTIONS

Extreme caution should be exercised when taking measurements under the following situations:

- (1). When measuring high voltages in excess of 20 volts.
- (2). Avoid physical contact when measuring AC power.
- (3). Avoid measuring voltage and current in humid or wet environments.

- (4). Never use meter test probes (the metal section) and other accessories that are in abnormal condition. This includes damage, bending, breakage, attachment of foreign objects and unobservable internal damage.
- (5). Avoid contacting exposed metal (conductive) parts, including the tested points, sockets, fasteners and wiring.
- (6). Always insulate yourself from circuits being measured.
- (7). Never install a fuse that is of larger capacity than the unit originally used in the meter or use a replacement fuse that does not meet the recommended specifications.
- (8). Never operate the meter where explosive or flammable gas (or material) are present or in environments having a high dust content.

8. IMPORTANT RECOMMENDATIONS

This electrical meter is a high precision instrument.

To maintain full accuracy, users must not exceed the previously described specifications regarding operation and storage. Other recommendations include:

- (1). Do not measure voltages that exceed DC 1000V and AC 750V rms.
- (2). For maintenance, use a soft dry cloth for cleaning the unit. Never use a wet cloth, solvents or water, etc.
- (3). Remove the batteries if the unit will not be operated for an extended length of time. Also, do not store the unit in areas of high temperature and humidity.

TENMARS



Professional Electrical and Environment Test & Measurement Instruments:

Battery Capacity / Impedance Tester, TACHO Meter ,LED light meter, Temperature & Humidity meter ,Infrared Thermometer, Sound level meter ,Light meter, EMF meter, UV Light meter, RF meter, Hot wire Anemometer, CO meter Anemometer, Lan cable tester, CO₂ meter, Solar power meter, Radiation meter, Clamp meter, Multimeter, Phase Rotation test, Digital Insulation tester

**Our products of high quality are selling
well all over the world**

TENMARS ELECTRONICS CO., LTD
6F, 586, RUI GUANG ROAD, NEIHU,
TAIPEI 114, TAIWAN.

E-mail: service@tenmars.com
<http://www.tenmars.com>